

# Work Order ID 82361

March-29-12 2:34:31 PM

**\*82361\***

Page 1

Item ID: D3391-021 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Tube Assembly  
 Start Date: 29/03/2012 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 12/04/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: MLJ Date: 12/03/29 Tooling: Date: Run Start **\*NR1\***  
 QC: Date: SPC (Y/N): Date: Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3391	1								

100 Skidtubes 0.00  
**\*100\***  
 Skidtubes Memo 0.00  
 Skidtubes Cut extrusion to 46.52 +0.010 -0.020

Re 12/05/01

110 BENDING MACHINE - SKIDTUBES 0.00  
**\*110\***  
 CNC Bend 1 Memo 0.00  
 CNC Delta 100 Bender Bend as per Dwg D3391 Using Bend Prog 3391021

Re 12/05/01

120 QC5- Inspect part completeness to step on W/O 0.00  
**\*120\***  
 QC Memo 0.00  
 Quality Control

6.75"

DP 12-5-1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 82361

March-29-12 2:34:31 PM

**\*82361\***

Page 2

Item ID: D3391-021 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Tube Assembly  
 Start Date: 29/03/2012 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 12/04/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	HAAS CNC VERTICAL MACHINING #1	0.00							
<b>*130*</b>									
HAAS 1	Memo	0.00							
HAAS CNC vertical machine #1	1-Machine as per Folio FA590 Rev <u>AA</u> & Dwg D3391 Rev. <u>I</u> Identify as D3391-1 2-Deburr			<u>2L</u>	<u>12-05-04</u>	<u>0</u>			
140	QC2- Inspect parts off machine FAI/FAIB	0.00							
<b>*140*</b>									
QC	Memo	0.00							
Quality Control				<u>2L</u>	<u>12-05-04</u>				
150	CONVENTIONAL MILLING MACHINE	0.00							
<b>*150*</b>									
Mill Conv	Memo	0.00							
Conventional Milling Machine	Drill X1 Aft cap as per Dwg D3391 .1875" dia			<u>90</u>	<u>12-05-07</u>	<u>1</u>			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 82361**

March-29-12 2:34:31 PM

**\*82361\***

Page 3

Item ID: D3391-021

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Item Name: Fwd Tube Assembly

Stop **\*NS2\***

Start Date: 29/03/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 12/04/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

160

QC2- Inspect parts off machine FAI/FAIB

0.00

**\*160\***

QC

Memo

0.00

12-05-07

Quality Control

170

QC8- Inspect parts - second check

0.00

**\*170\***

QC

Memo

0.00

12/05/09

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 82361

**\*82361\***

Page 4

March-29-12 2:34:31 PM

Item ID: D3391-021 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Tube Assembly  
 Start Date: 29/03/2012 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 12/04/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start **\*NR1\***  
 QC: Date: SPC (Y/N): Date: Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180

**\*180\***

Skidtubes

Skidtubes

Skidtubes

Memo

0.00

1-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

2-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)  
(ONLY DRILL HOLES MARKED "A")

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5- open float bag holes 0.328" and counter sink as per dwg D3391

6-Deburr & Scribe Batch number Inside aft end.

7-Transfer drill D3391-021 with D3391-023

\*\*\*NO WEARPLATE HOLES ARE TRANSFER DRILLED\*\*\* - DC 12/06/220

DC 12/05/22

190

**\*190\***

QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

5/7/06/170

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Work Order ID 82361

March-29-12 2:34:31 PM

**\*82361\***

Page 5

Item ID: D3391-021

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Item Name: Fwd Tube Assembly

Stop **\*NS2\***

Start Date: 29/03/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 12/04/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	Chemical Conversion Coat per QSI005 4.1	0.00							
<b>*200*</b>									
HandFinish	Memo	0.00							
Hand Finishing									
210	QC7-Inspect Chemical Conversion Coat	0.00							
<b>*210*</b>									
QC	Memo	0.00							
Quality Control									
220		0.00							
<b>*220*</b>									
Skidtubes	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	1-instal spacers as per dwg D3391 A/R Magnabond 6398 batch: 120666 exp. date: 13-1-30 cure time 12hrs. as per QSI015 2- grind crossbolt flush 3-back drill crossbolt if necessary								

1 12-6-20

DP 12-6-22

12-6-22

DP  
CF 12-6-25

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 82361

March-29-12 2:34:31 PM

**\*82361\***

Page 6

Item ID: D3391-021 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Tube Assembly  
 Start Date: 29/03/2012 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 12/04/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230 <b>*230*</b> QC Quality Control	QC5- Inspect part completeness to step on W/O  Memo	0.00  0.00				1			120625
235 <b>*235*</b> HandFinish Hand Finishing	Pressure Wash per QSI005 4.3  Memo AND REALODINE AS PER PAR09-043	0.00  0.00				1x	1	120625	
240 <b>*240*</b> Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum  Memo START TIME: 8:30 OVEN TEMPERATURE: 300° FINISH TIME: 9:00	0.00  0.00				1	1	120626	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 82361

March-29-12 2:34:31 PM


**\*82361\***

Page 8

Item ID: D3391-021 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Tube Assembly  
 Start Date: 29/03/2012 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 12/04/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	Identify as per dwg & Stock Location <u>w10</u>	0.00	0412-7412-043/385250			1x	4	11/06/27	
<b>*260*</b>									
Packaging	Memo	0.00							
Packaging									
280	QC21- Final Inspection - Work Order Release	0.00							
<b>*280*</b>									
QC	Memo	0.00							
Quality Control									

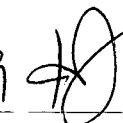12/6/29 

MF  
12-06-28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

March-29-12 2:34:35 PM

Page 1

Work Order ID: 82361

\*82361\*

Parent Item: D3391-021

\*D3391-021\*

Parent Item Name: Fwd Tube Assembly

Start Date: 29/03/2012

Required Date: 12/04/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.09.13New issue KJ/JLM  
 IPP B06.02.10Dwg rev.D ecn 773 EC  
 IPP C06.05.02Added inspections EC  
 IPP D 07.03.13 rev F dwg EC  
 IPP E 07.11.07 revG dwg ecn1053P EC verified by: DD  
 IPP Rev:f ECN 1056 07-11-12 DD verified by: EC  
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC  
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC  
 IPP Rev I 09.02.02 added hardware EC verified by: DD IPP Rev:J  
 11.11.14 AS PER REV.I DD verified by:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4095-051		Manufactured	No			255	Each	13.0000	1	1			
<p>*D4095-051*</p> <p>Wearpad Assembly</p> <p>381613 ** (x) 11/04/12</p>													

Location	Loc Qty	Loc Code
----------	---------	----------

FP001	3	
78821	3	
FP002	10	
78914	10	

D6013-047		Manufactured	No			100	Each	102.0000	1	1			
<p>*D6013-047*</p> <p>Skidtube Material</p> <p>** DC 12/05/01</p>													

Location	Loc Qty	Loc Code
----------	---------	----------

LG	102	
72505	102	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

March-29-12 2:34:35 PM

Page 2

Work Order ID: 82361

\*82361\*

Parent Item: D3391-021

\*D3391-021\*

Parent Item Name: Fwd Tube Assembly

Start Date: 29/03/2012

Required Date: 12/04/2012

Start Qty: 1.00

Required Qty: 1.00

D3670-4-200

Manufactured No

220

Each

103.0000

4

4

\*D3670-4-200\*

SPACER

\*\*

DP 12-6-22

Location

Loc Qty

Loc Code

LG

84504

76

80360

76

LG001

27

72851

3

78606

24

(4)

D3401-041

Manufactured No

255

Each

6.0000

1

1

\*D3401-041\*

Tow Cap Assembly

\*\*

12/06/27

Location

Loc Qty

Loc Code

FP002

6

1383432

78990

6

11

AN960C10L

NAS1149C0332

Purchased

No

255

Each

0.0000

10

10

\*AN960C10I \*

washer

\*\*

M122063

(no) 12/06/27

March-29-12 2:34:36 PM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

March-29-12 2:34:36 PM

Page 3

Work Order ID: 82361

\*82361\*

Parent Item: D3391-021

\*D3391-021\*

Parent Item Name: Fwd Tube Assembly

Start Date: 29/03/2012

Required Date: 12/04/2012

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

255

Each

3,174.000

10

10

\*AN3C4A\*

BOLT

\*\*

Yl 12/06/27

Location

Loc Qty

Loc Code

ST350

3174

117688

5

118112

16

119749

10

120187

1992

120423

10

120521

64

120769

38

120799

23

120930

16

121205

1000

X10

D3672-1

Manufactured

No

255

Each

1,038.000

4

4

\*D3672-1\*

Phenolic Washer

\*\*

Yl 12/06/27

Location

Loc Qty

Loc Code

FP001

34

66821

34

ST060

1004

72229

4

76277

500

80369

500

Yl

AEIS-1032-225

Purchased

No

255

Each

0.0000

10

10

\*AFI S-1032-225\* Y AWS7-1032-225 / M118520

INSERT

\*\*

(no) Yl 11/06/27

March-29-12 2:34:36 PM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector



Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



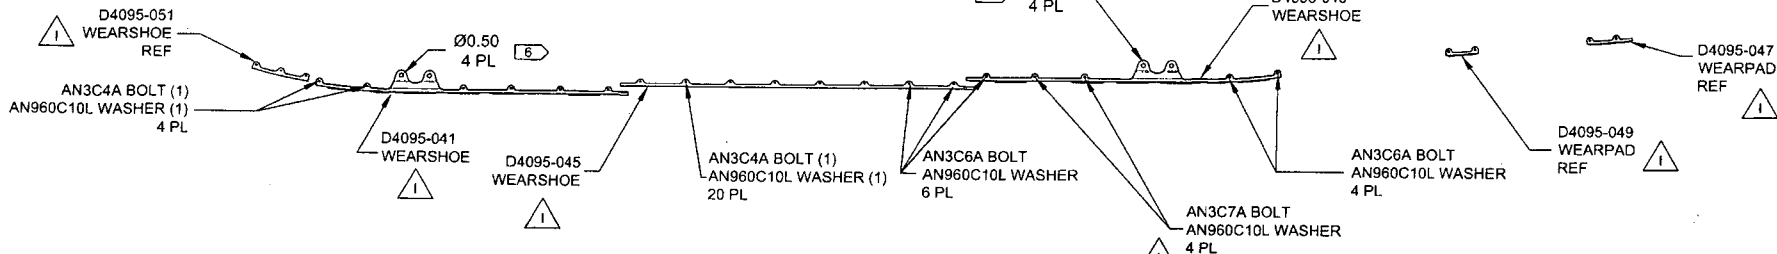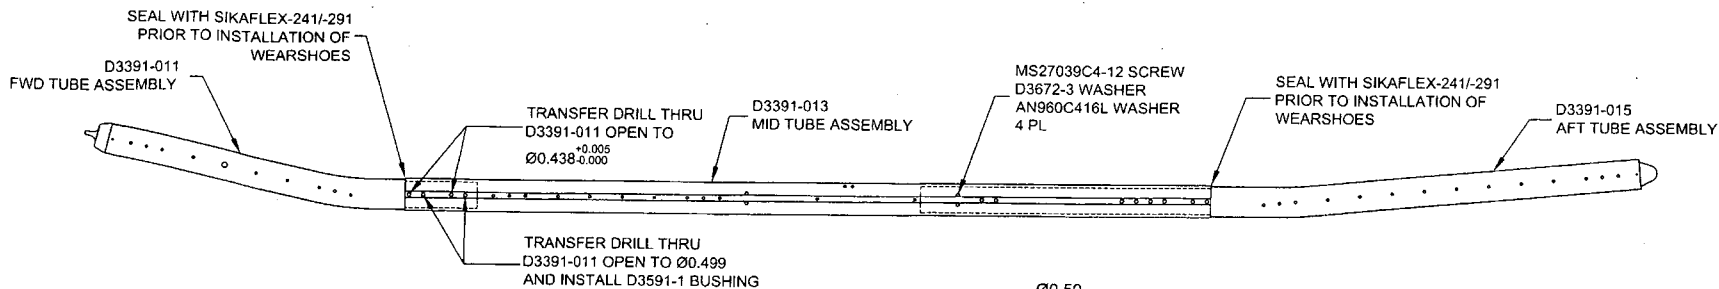

**D3391-041 ASSEMBLY**

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER

**GENERAL NOTES**

- 1). FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2). COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"  
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3). TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4). UNITS: INCHES UNLESS OTHERWISE NOTED
- 5). USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES  
FOR WEARSHOE INSERTS. C-BORE AS NOTED AND INSTALL INSERTS EXCEPT  
WHERE INDICATED.
- 6). FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH  
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND  
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7). FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH  
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND  
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

**D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARSHOE
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

RELEASED  
2011-11-04  
BCN#11-662

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A8-4, ZN B6-8, LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D8-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH		
DRAWN	XDF		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	11.10.13		

**DART AEROSPACE USA, INC**  
KENT, WA


DRAWING NO. REV. I  
D3391 SHEET 1 OF 8

TITLE SCALE  
412 FLOAT SKIDTUBE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



82361

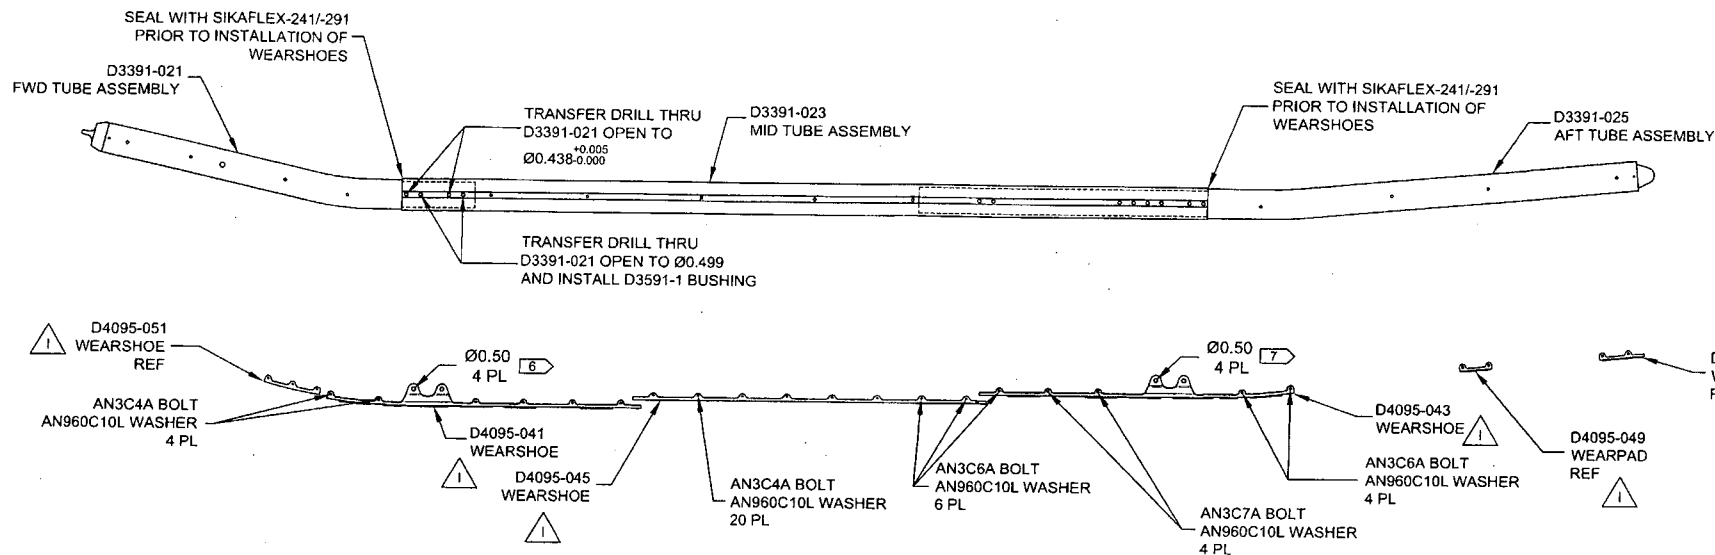

**D3391-043 ASSEMBLY**

**D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
30	AN960C10L	WASHER

**GENERAL NOTES**


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED  
2011-11-04


DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

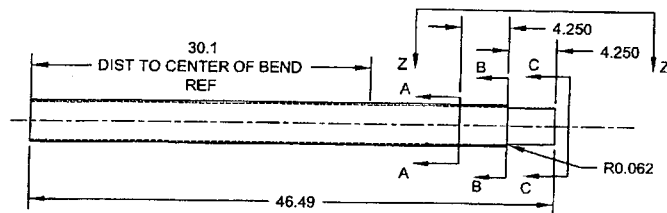


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

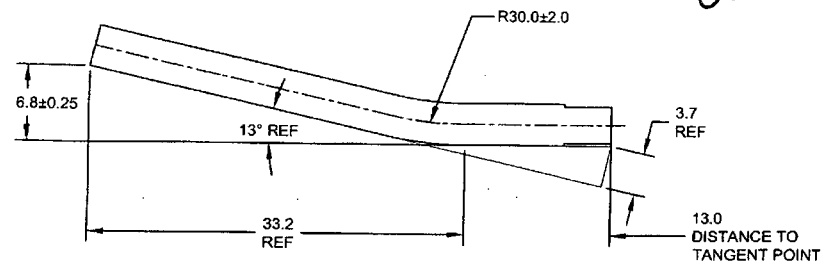


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

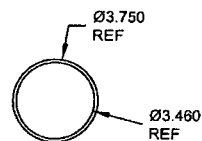


**SECTION A-A**  
SCALE 2X

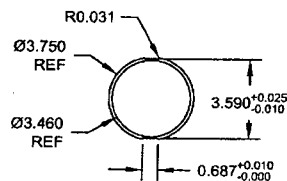

**SECTION B-B**  
SCALE 2X

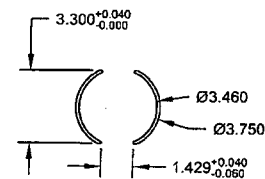

**SECTION C-C**  
SCALE 2X

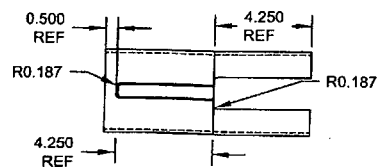


**VIEW Z-Z**  
SCALE 2X

RELEASED  
2011-11-04


DART AEROSPACE USA, INC		
DESIGN	PH	KENT, WA
DRAWN	XDF	
CHECKED		DRAWING NO. REV. 1
MFG. APPR.		D3391 SHEET 3 OF 8
APPROVED		TITLE SCALE
DE APPR.		412 FLOAT SKIDTUBE NTS
DATE	11.10.13	

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


82361

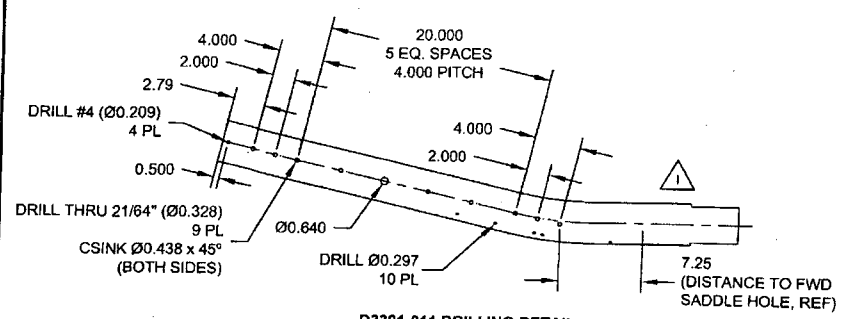


**D3391-011 DRILLING DETAIL**

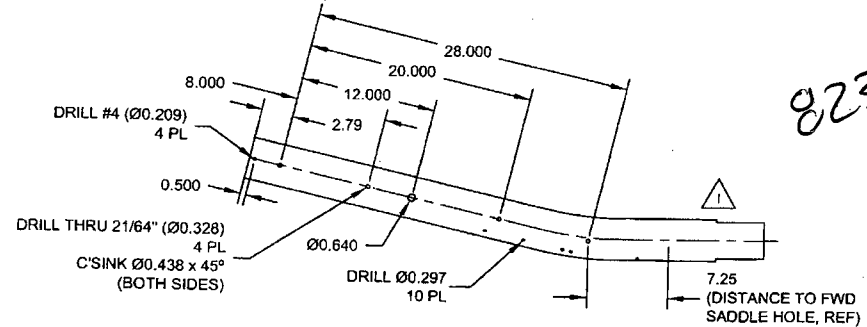

**D3391-021 DRILLING DETAIL**

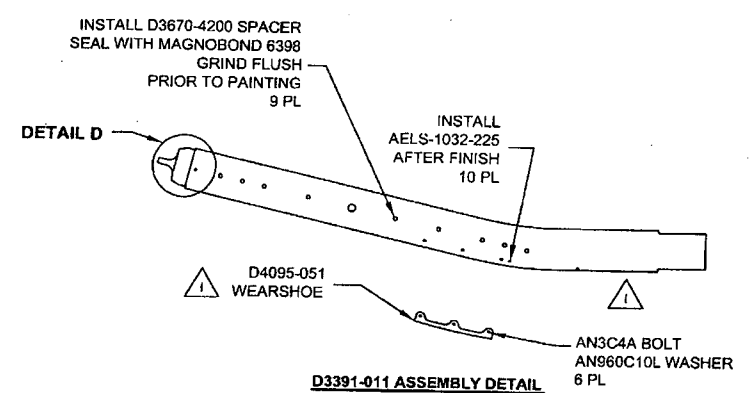


**D3391-011 ASSEMBLY DETAIL**

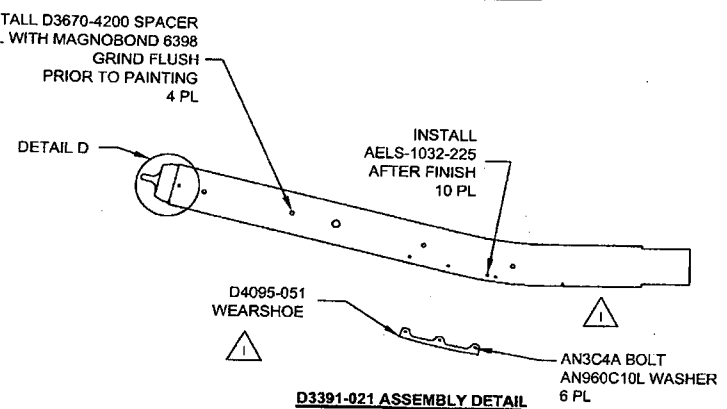

**D3391-021 ASSEMBLY DETAIL**

**D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST**


QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT

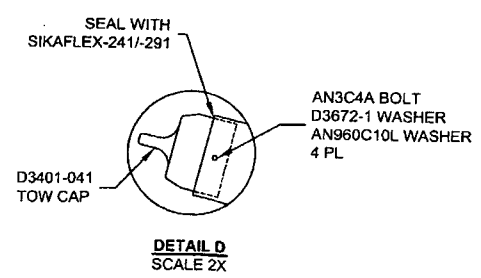

**DETAIL D  
SCALE 2X**


RELEASED  
2011-11-04

DESIGN		PH		<b>DART AEROSPACE USA, INC</b>	
DRAWN		XDF		KENT, WA	
CHECKED				DRAWING NO. REV. 1	
MFG. APPR.				D3391 SHEET 4 OF 8	
APPROVED				TITLE SCALE	
DE APPR.				412 FLOAT SKIDTUBE NTS	
DATE		11.10.13		COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRINTED AND COPIED/REPRODUCED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.					

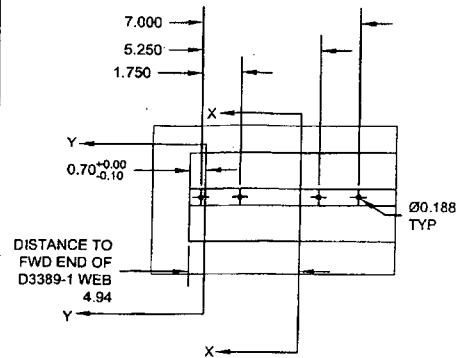


**DETAIL J**  
SCALE 4X

DRILL THRU 21/64" (Ø0.328)  
CSINK Ø0.438 X 45° (BOTH SIDES)  
12 PL

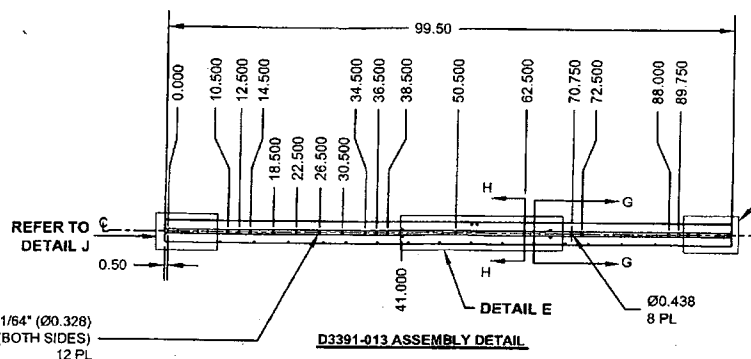


**D3391-013 ASSEMBLY DETAIL**

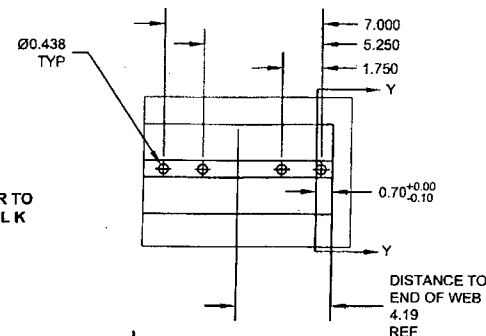


**DETAIL K**  
SCALE 4X




**SECTION G-G**  
SCALE 5X

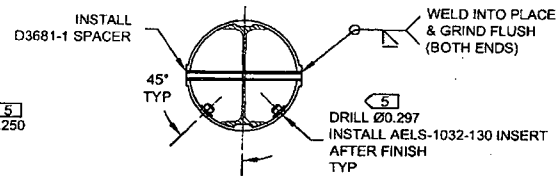

**SECTION H-H**  
SCALE 5X

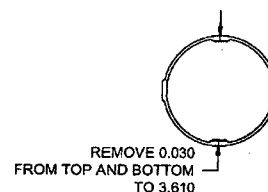

**SECTION X-X**  
SCALE 5X

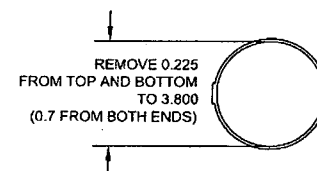


**SECTION Y-Y**  
SCALE 5X

**D3391-013 MID TUBE ASSEMBLY PARTS LIST**

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW


**D3391-013 MID TUBE ASSEMBLY**

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

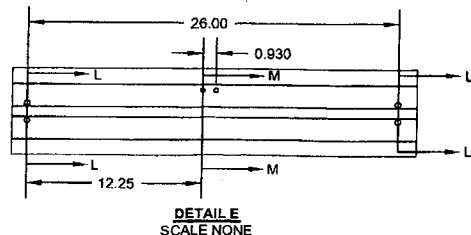


**DETAIL E**  
SCALE NONE


DRILL Ø0.391  
INSTALL ALS4-428-165 INSERT  
MS27039C4-08 SCREW  
D3672-3 WASHER  
AN960C416L WASHER  
AFTER FINISH  
4 PL

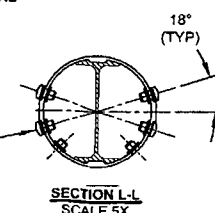

**SECTION L-L**  
SCALE 5X

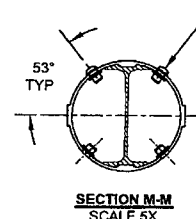


**SECTION M-M**  
SCALE 5X

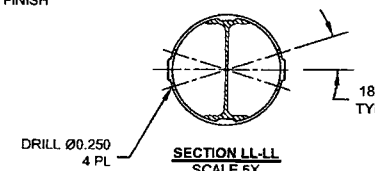


**SECTION LL-LL**  
SCALE 5X

RELEASED  
2011-11-04


DESIGN		PH		DART AEROSPACE USA, INC	
DRAWN		XDF		KENT, WA	
CHECKED				DRAWING NO. REV. I	
MFG. APPR.				D3391 SHEET 5 OF 8	
APPROVED				TITLE SCALE	
DE APPR.				412 FLOAT SKIDTUBE NTS	
DATE		11.10.13		COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.					

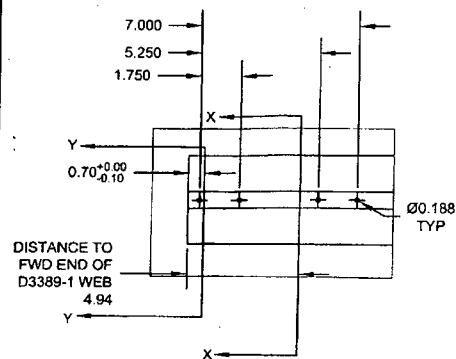

DETAIL J  
SCALE 4X

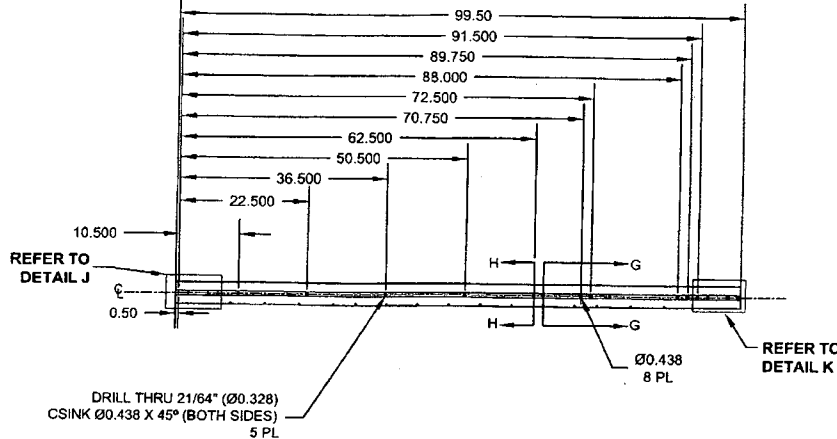


D3391-023 ASSEMBLY DETAIL

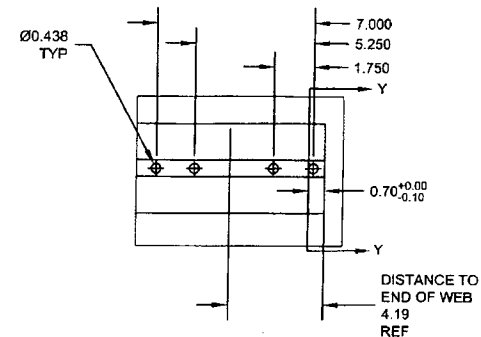


DETAIL K  
SCALE 4X




SECTION G-G  
SCALE 5X

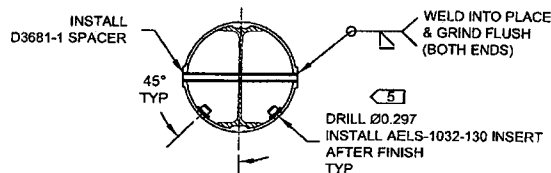

SECTION H-H  
SCALE 5X

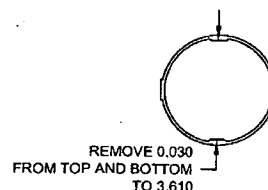

SECTION X-X  
SCALE 5X

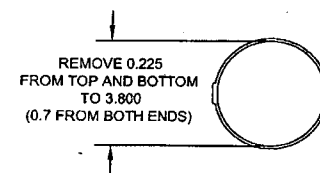

SECTION Y-Y  
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST


QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED  
2011-11-04


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

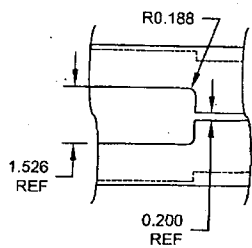


**VIEW BB-BB**  
SCALE 4X

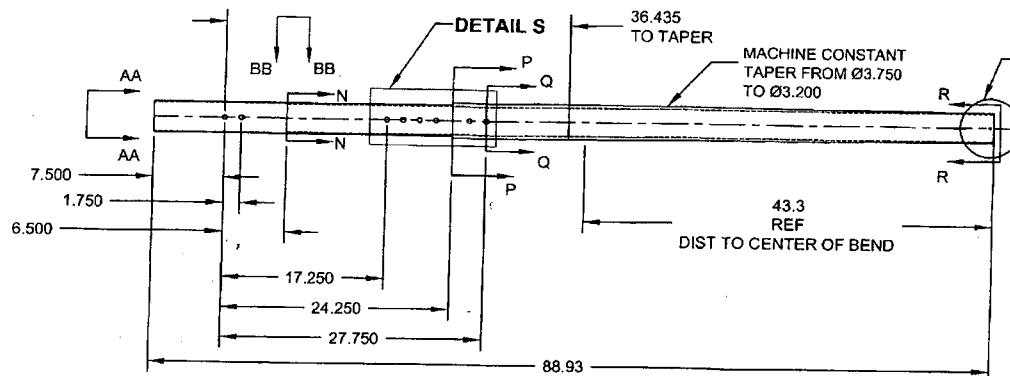


**D3391-3 AFT DRILLING AND CUTTING DETAIL**  
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

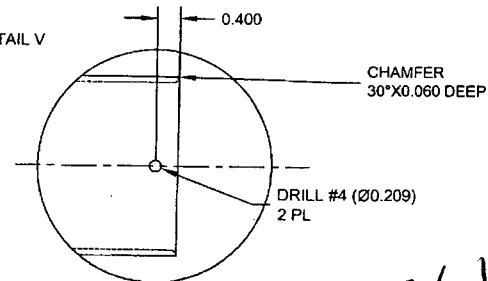


**DETAIL V**  
SCALE 6X

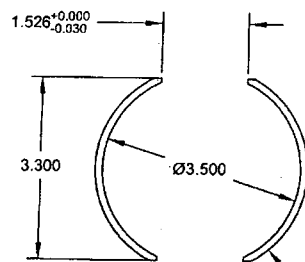


**SECTION AA-AA**  
SCALE 6X

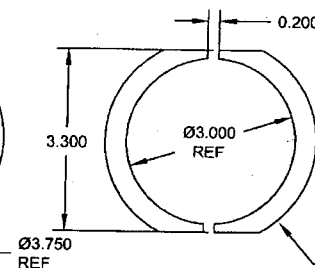


**SECTION N-N**  
SCALE 6X

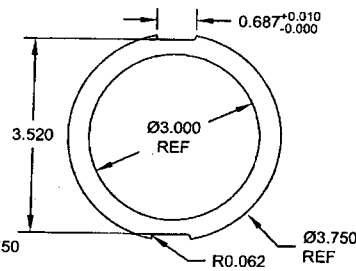


**SECTION P-P**  
SCALE 6X

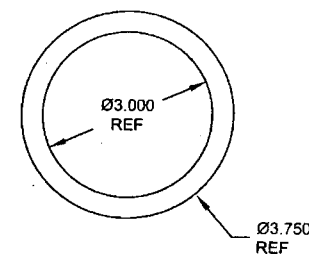


**SECTION Q-Q**  
SCALE 6X

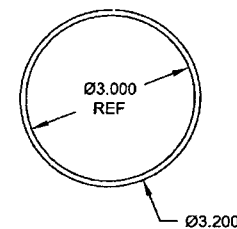

**SECTION R-R**  
SCALE 6X

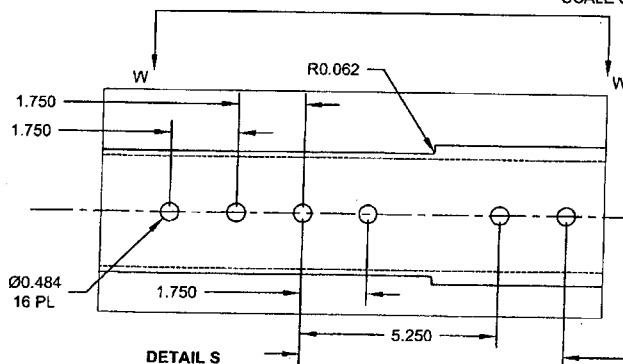

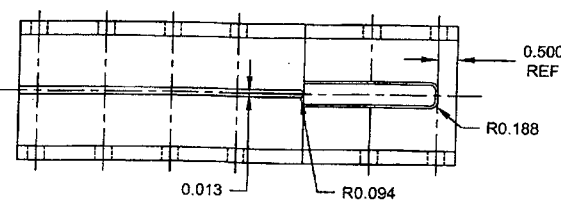


**DETAIL S**  
SCALE 4X




**VIEW W-W**  
SCALE 4X


**RELEASED**  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV.
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL, AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


82361

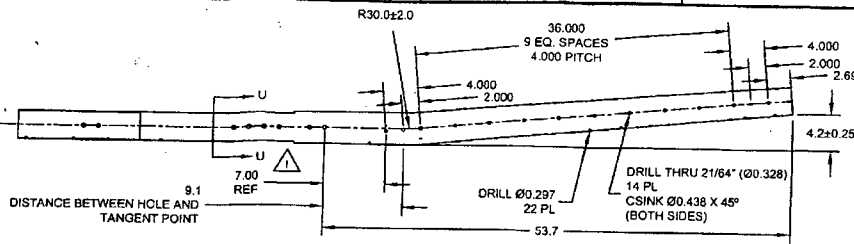


**D3391-015 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

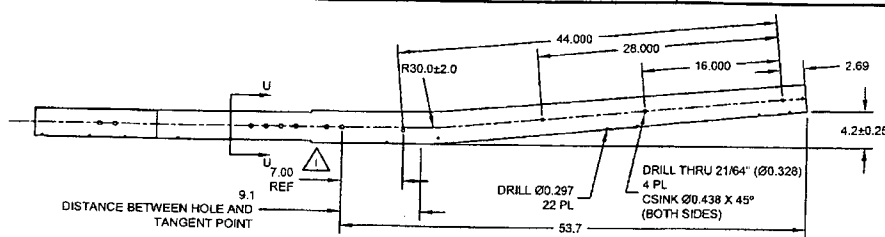

**D3391-025 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

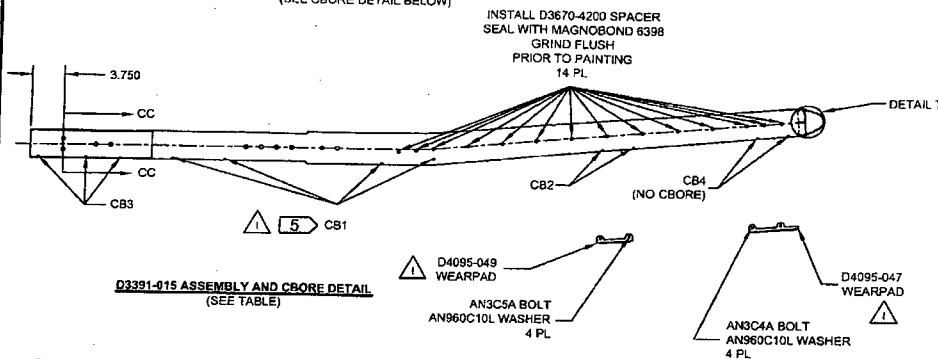



**D3391-015 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

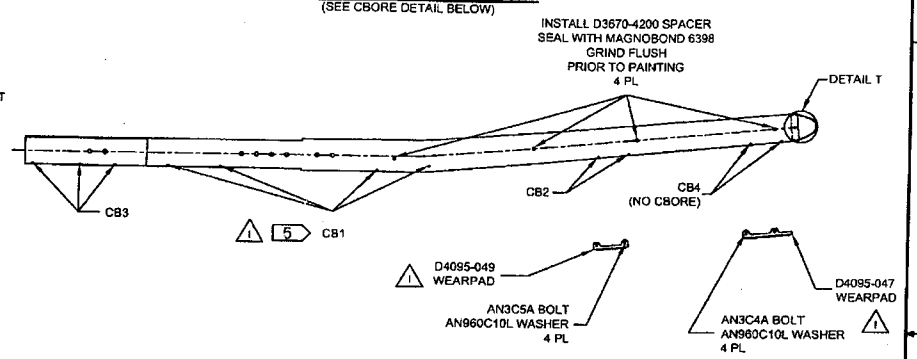


**D3391-025 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

**D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST**

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
8	8	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

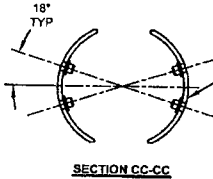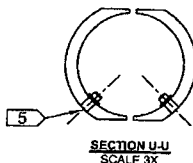

DRILL Ø0.391  
CBORE Ø0.516 X 0.040 DEEP  
INSTALL ALS4-428-165 INSERT  
4 PL

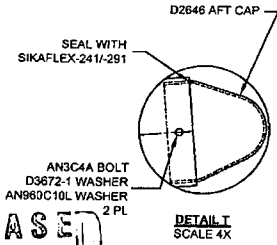

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND  
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

RELEASED  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO. D3391	REV. 1
MFG. APPR.		SHEET 8 OF 8	
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	